



Pacific Accessory Corporation

-Displaying video on far rear screen in applicable vehicles


Symptoms: Video is not displayed on far rear screen.

Reason: We have found that there is a separate video feed for the far rear screen.

Solution: Below is a picture of the connector in which four wires need to be connected for video to be displayed on the far rear screen. For reference this is the male connector on the GMRVD2 harness and the pin view is from the wire side (see image with arrow for reference).

Pin 8 needs to be spliced with Pin 10

Pin 18 needs to be spliced with Pin 20

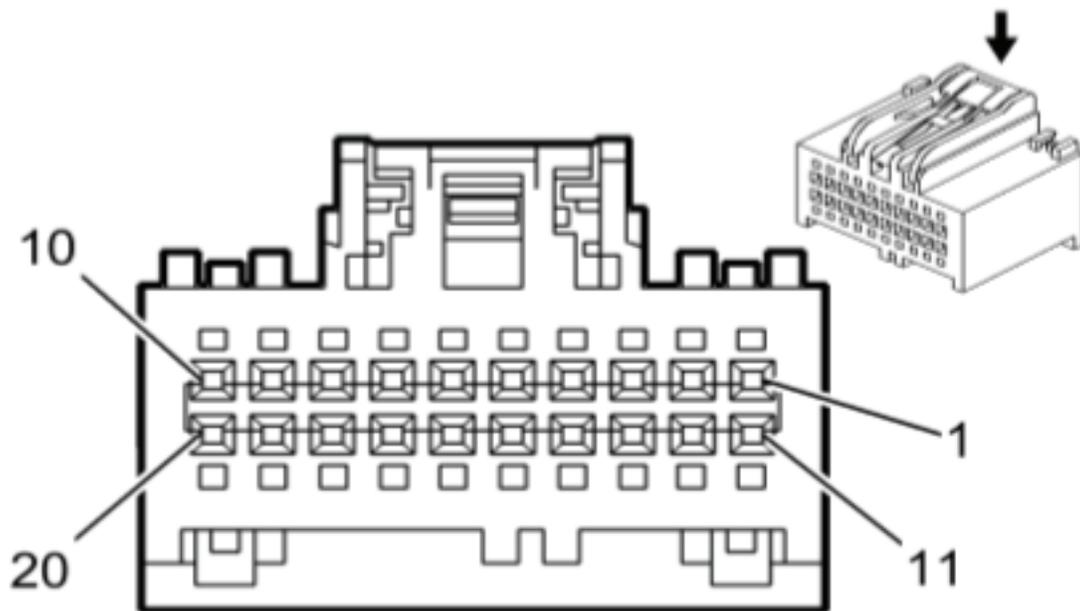

Pin 8 - Lt. Green - Screen 2 Video +
Pin 10 - Green/Black - Screen 1 Video +
Pin 18 - White - Screen 2 Video -
Pin 20 - White/Black - Screen 1 Video -